


# **Energy rating and score**

This property's current energy rating is E. It has the potential to be D.

<u>See how to improve this property's energy efficiency.</u>

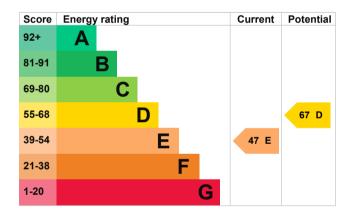

The graph shows this property's current and potential energy rating.

Properties get a rating from A (best) to G (worst) and a score. The better the rating and score, the lower your energy bills are likely to be.

For properties in Northern Ireland:

the average energy rating is D the average energy score is 60

# Breakdown of property's energy performance

#### Features in this property

Features get a rating from very good to very poor, based on how energy efficient they are. Ratings are not based on how well features work or their condition.

Assumed ratings are based on the property's age and type. They are used for features the assessor could not inspect.

Feature	Description	Rating
Wall	Granite or whinstone, as built, no insulation (assumed)	Very poor
Wall	Granite or whinstone, as built, partial insulation (assumed)	Average
Roof	Roof room(s), insulated (assumed)	Good
Window	Fully double glazed	Good
Main heating	Room heaters, electric	Very poor
Main heating control	Appliance thermostats	Good
Hot water	Electric instantaneous at point of use	Very poor
Lighting	Low energy lighting in all fixed outlets	Very good
Floor	(other premises below)	N/A
Secondary heating	None	N/A

## Primary energy use

The primary energy use for this property per year is 342 kilowatt hours per square metre (kWh/m2).

#### **Additional information**

Additional information about this property:

· Stone walls present, not insulated

# How this affects your energy bills

An average household would need to spend £3,181 per year on heating, hot water and lighting in this property. These costs usually make up the majority of your energy bills.

You could **save £1,454 per year** if you complete the suggested steps for improving this property's energy rating.

This is **based on average costs in 2023** when this EPC was created. People living at the property may use different amounts of heating, hot water and lighting.

# **Environmental impact of this property**

This property's current environmental impact rating is E. It has the potential to be E.

Properties get a rating from A (best) to G (worst) on how much carbon dioxide (CO2) they produce each year. CO2 harms the environment.

#### **Carbon emissions**

An average household produces

6 tonnes of CO2

This property produces 4.5 tonnes of CO2

This property's potential 4.5 tonnes of CO2 production

You could improve this property's CO2 emissions by making the suggested changes. This will help to protect the environment.

These ratings are based on assumptions about average occupancy and energy use. People living at the property may use different amounts of energy.

# Changes you could make

Step	Typical installation cost	Typical yearly saving
1. Flat roof or sloping ceiling insulation	£850 - £1,500	£111
2. High heat retention storage heaters	£1,200 - £1,800	£1,343
3. Internal or external wall insulation	£4,000 - £14,000	£133

# Paying for energy improvements

You might be able to get a grant from the <u>Boiler Upgrade Scheme (https://www.gov.uk/apply-boiler-upgrade-scheme)</u>. This will help you buy a more efficient, low carbon heating system for this property.

## Who to contact about this certificate

## **Contacting the assessor**

If you're unhappy about your property's energy assessment or certificate, you can complain to the assessor who created it.

Assessor's name Kathleen Bellew Telephone 00353868410785

Email <u>kathleenbellew@outlook.com</u>

## Contacting the accreditation scheme

If you're still unhappy after contacting the assessor, you should contact the assessor's accreditation scheme.

Accreditation scheme Elmhurst Energy Systems Ltd

Assessor's ID EES/019556
Telephone 01455 883 250

Email <u>enquiries@elmhurstenergy.co.uk</u>

#### About this assessment

Assessor's declaration

Date of assessment

Date of certificate

Type of assessment

No related party
26 May 2023
31 May 2023
RdSAP